



DAIMLER TRUCK

Possible causes of fault

- Component 'B621 (Exhaust gas recirculation (AGR) differential pressure sensor)' is damaged.
- The electric lines of component part 'B621 (Exhaust gas recirculation (AGR) differential pressure sensor)' have loose contact, corroded pins or other faults.
- Component 'B621 (Exhaust gas recirculation (AGR) differential pressure sensor)' or its electrical line has a short circuit to ground or an open circuit.
- The electrical connectors on the affected components are damaged, moist, corroded or loose.
- CAN communication is faulty or disrupted.
- There are fault codes present for component 'Y621 (Exhaust gas recirculation controller)'.
- Cooling of component 'Y621 (Exhaust gas recirculation controller)' is not guaranteed.
- Component 'Y621 (Exhaust gas recirculation controller)' is mechanically damaged or it sticks.
- The exhaust gas recirculation flap is mechanically damaged or jammed.
- The exhaust gas recirculation cooler is clogged or excessively soiled.

Further notes / Instructions

- The test is started with the 'Continue' button.