


Alternator failure – regulator functional checking



Vehicle Model	: MB Axor 2528 CH
VIN	: MEC2437BAPP131687
TIPS Case date	: -
Failure mileage & hourmeter	: 41137/3739
Alternator batch code	: Batch Code Missing

- a. Keep the Multimeter **Black probe** at Regulator **Terminal-1** & **Red probe** at Alternator body: 0.4V to 0.6V – **Found OK**, Else **Not OK**

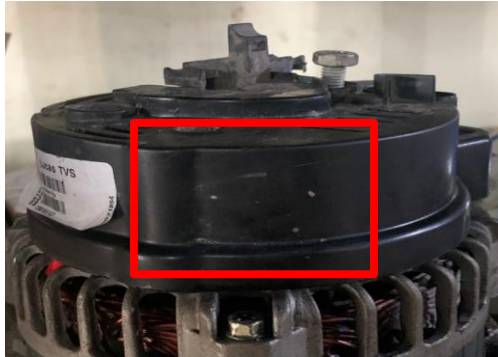

Result: OK
0,420 V

- b. Keep the Multimeter **Black probe** at Regulator **Terminal-2** & **Red probe** at Alternator body: 0.4V to 0.6V – **Found OK**, Open load (OL) – **Resistor lead cut**



Result: Not OK
0,372 V